





Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET				
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	401511	King Street, Woodmansey HU17 0TE	1 of 3				
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Jill Climber - Yellow on Black Welpour	Wicksteed	L	Paint is wearing. Recommend this item is rubbed down and repainted. Note that BS EN 1176:2017 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre.						
RP 182 2.4m 1 Bay Swing 2 x Cradle Seats on Black Welpour	Record 1995	L	Generally satisfactory, but the swing frame would benefit from repainting (red) Recommend bird faeces are removed from the seats as required to reduce health hazards to users. Monitor the corrosion on the nuts on the underside of the seats.						
Free Standing Slide on Black Welpour	Record	L	Monitor gaps at the edge of the welpour playing surface for trip hazards.						
Whale Spring Mobile - Blue on Black Welpour	Ledon	L	Monitor minor damage to the handrail for sharp edges etc.						
Elephant Spring Mobile - Yellow Model 414 on Black Welpour	Ledon 2007	L	Monitor minor corrosion on the spring.						
2.4m 1 Bay Swing 2 x Flat Seats on Black Welpour	Record	L	Monitor minor damage to the footrests and hand holds.						
Storm Multiplay Unit with Curved Slide Chute on Black Welpour	Record	L	Monitor wear and dips in the red welpour playing surface below the seats.						
	Wicksteed	L	Paint is wearing, in particular at access and climbing areas. Recommend affected areas are rubbed down and repainted. Note that BS EN 1176:2017 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre.						
 			INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY: - A J Hayes DATE: - 16.05.2018		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered		£0.00 £0.00 £0.00 See sheet 3
Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028									



Continues on next sheet...



Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barrn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	401511	King Street, Woodmansey HU17 0TE	2 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Agility Unit with Grey Posts on Black Weipour	unknown	L	Monitor the splits where the weipour edges have been repaired for trip hazards. Monitor wear on the paintwork. Fails BS EN 1176 Head & Torso Probe Test at 1 opening in the blue frame (Ref BS EN 1176:2017 Part 1 Section 4.2.7.2) No remedial action is feasible at present.					
Free Standing Basketball Goal on Concrete	Parkdale PPL	L	Monitor cracks in the concrete surface for trip hazards.					
2 x Football goals on Grass	unknown	L	Generally satisfactory, but recommend grounds maintenance as required to reduce hazards at areas of ground erosion.					
Perforated Metal Seats	Record	L	Generally satisfactory, but the seat near the unit with silver posts would benefit from repainting (corrosion)					
Litter Bins	unknown		Satisfactory condition.					
2 x Timber Seats	unknown	L	Generally satisfactory, but the raised edges of the concrete slabs may create trip hazards. Recommend grounds maintenance as required.					
Metal Bow Top Fence	unknown		Satisfactory condition, but fails BS EN 1176 Head & Neck Probe Test. Ref BS EN 1176:2017 Part 1 Section 4.2.7.2. No action recommended at present.					
Pedestrian Gates	unknown	L	Generally satisfactory, but monitor for potential pinch hazards (minimum 12mm gap recommended, ref BS EN 1176:2017 Part 1, section 4.2.7.6) Recommend grounds maintenance as required to reduce trip hazards at areas of ground erosion, exposed concrete and metal ground strips.					
 		Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028						
			INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY: - A J Hayes DATE: - 16.05.2018	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered			£0.00 £0.00 £0.00 See sheet 3



Continues on next sheet...

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	401511	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	1 of 4			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Roundabout on Black Wetpour	Record		Satisfactory condition, but the item is stiff to rotate. Bearings were greased at the time of inspection. Costs to replace the bearings if required are available on request.					
RP 163 1.8m 2 Bay Swing 3 x Cradle Seats on Black Wetpour	Record 2008	L	Recommend bird faeces are removed from the seats as required to reduce health hazards to users.					
		L	Monitor minor damage to the crutch strap on the orange seat.					
		L	Monitor the splits where the wetpour edges have been repaired for trip hazards.					
Car Spring Mobile on Blue / Black Wetpour	Record	L	Monitor minor damage to the seat back rest.					
		L	Monitor gaps at the edges of the wetpour playing surface for trip hazards. Some edges have been repaired previously.					
Multiplay Unit on Black Wetpour	Record	L	Monitor minor damage around the fixing holes on the purple ramp panel for sharp edge hazards. Costs to replace the panel are available on request.					
		L	Paint is wearing at the access and climbing areas. Recommend the affected areas are rubbed down and repainted.					
		L	Note that BS EN 1176:2017 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre, or £92.50 per 5 litre tin.					
		L	Monitor impact damage to the slide chute.					
		L	Inspector was unable to tighten the protruding bolt on the underside of the platform at the time of the inspection. The platform is secure, and no hazards are created.					
			INDICATION OF RISK RATING ASSESSMENT	INSPECTED BY: - A J Hayes DATE: - 16.05.2018		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered		£0.00 £0.00 £0.00
			VERY LOW & LOW RISK - See Introductory Notes		Continues on next sheet...			See sheet 4



Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barrn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	401511	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	2 of 4			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2.4m 1 Bay Swing 2 x Flat Seats on Black Wetpour	Record	L	Monitor minor damage to the seats. Monitor split in 1 corner of the wetpour playing surface for trip hazards.					
2 x Talking Tubes	Record	L	Monitor minor damage. No hazards appear to be created at present.					
		L	Recommend grounds maintenance as required to reduce slip / trip hazards at areas of ground erosion.					
		L	Monitor security of ground fixing. Slight movement evident at the time of the inspection.					
Rotaweb Climber on Black Wetpour	Tayplay	L	Falls BS EN 1176 Ground Clearance. Minimum 400mm recommended, approximately 380mm actual below the outer ring (Ref BS EN 1176:2017 Part 5 Section 5.5.4) No remedial action is recommended at present. Monitor area of damage to the rope sections for exposed metal strands which may create hazards to users. 1 area of damage has been taped over as a short term measure. Additional tape was fitted at the time of the inspection.					
		L	Tayplay advise that the only long term solution would require the net to be removed and returned to Tayplay for repair or replacement. The item is safe for continued use. Recommend monitoring at present, as part of your regular inspections, and at Wicksteed quarterly inspections.					
Spring See-Saw on Black Wetpour	Ledon	L	Generally satisfactory, but the foot rests fail BS EN 1176 Ring Gauge Test at 1 end (Ref BS EN 1176:2017 Part 6 Section 4.7) No remedial action is recommended at present. Foot rests at the other end have recently been replaced.					
			INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY: - A J Hayes DATE: - 16.05.2018		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered		£0.00 £0.00 £0.00
 			Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028					
			Continues on next sheet...					

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET				
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	401511	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	3 of 4				
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Perforated Metal Seats on Grass	Record	L	Monitor security of the ground fixing of the seat near to the cradle seat swing. Recommend grounds maintenance as required to reduce slip / trip hazards at areas of mud and ground erosion.						
Litter Bin	Broxap	L	Satisfactory condition.						
Metal Bow Top Fence	unknown	L	Satisfactory condition.						
Single Leaf Gate	Wicksteed 2017	L	Generally satisfactory, but recommend grounds maintenance as required to reduce slip / trip hazards at areas of ground erosion and exposed concrete. The gate is not self-closing.						
Double Gates	Wicksteed 2017	M	Satisfactory condition. Not self-closing. The gates were open at the time of the inspection.						
General		M	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces) Monitor for any nettles or fungus growth in the grass areas, which should be removed as required. Recommend bird faeces are removed as required to reduce health hazards to users of the area. Recommend the intrusive foliage on the access path from the road is cut back as required to reduce hazards, in particular at eye level for children and adults. Recommend grounds maintenance as required to reduce trip hazards at the holes in the grass at the edges of the safely surfaces, in particular around the Multiply unit.						
 		Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	HM/MH M V/L/L	INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY: - A J Hayes DATE: - 16.05.2018	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00	See sheet 4
Continues on next sheet...									

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET				
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	401511	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	4 of 4				
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
General (continued)									
		L	All play equipment and surfaces would benefit from cleaning. The best method is to pressure wash with a mild detergent solution.						
		L	The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2017 clause 8.2.4)			A variety of signs are available from Wicksteed Sales Dept			
Outside Fenced Area									
Informal BMX Track	unknown	M	Recommend the discarded timber parts are removed from the area.						
Multi Sports Goal on Tarmac	Parkdale PPL	M	Satisfactory condition, but recommend the 4 wheeled metal frame is removed from the goal fence.						
Litter Bin	Wybone 2014		Satisfactory condition.						
 		Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk		INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- A J Hayes DATE :- 16.05.2018		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC. VAT	
		HM/M M V/L/L						£0.00 £0.00 £0.00 £0.00	

